

## SERVICE BULLETIN NO. OSB1078-174

### I. TECHNICAL DETAILS

#### 1.1 Category:

Optional

#### 1.2 Airplanes affected:

Description	LBA TCDS	EASA TCDS	FAA TCDS	Serial-Nr.
G 115C1 ACRO	1078	EASA.A.364	A57EU	82001-82084 (C)
G 115D	1078	EASA.A.364	A57EU	82001-82084 (D)
G 115D2	1078	EASA.A.364	A57EU	82001-82084 (D2)
G 115E	1078	EASA.A.364		82086/E-82185/E 82301/E-82323/E
G 115EG	1078	EASA.A.364	A57EU	82200-82273
G 115TA	1078	EASA.A.364		8501 - 8514

#### 1.3 Time of Compliance:

On holders discretion

#### 1.4 Subject:

ATA-Code: 11-30 Internal Placards and Markings  
Marking of the canopy emergency release handle

#### 1.5 Reason:

GROB received a customer request to mark the canopy emergency release handle of civil registered aircraft with yellow / black stripes in accordance with military regulations.

This Service Bulletin describes the procedure to optionally install the corresponding markings to the canopy lock covering.

#### 1.6 Concurrent documents:

N/A

### 1.7 Approval Note:

The technical content of this document is approved under the authority of EASA Design Organization Approval No. EASA.21J.030.

These information or instructions relate to change no. OÄM1078-127 which has been approved under the authority of EASA Design Organisation Approval No. EASA.21J.030.

### 1.8 Accomplishment/ Instructions

- 1.8.1 Ensure that the aircraft is safe for parking I.A.W. MM chapter 10-10.
- 1.8.2 Open canopy.
- 1.8.3 Apply yellow / black adhesive markings (qty. 2 P/N 115E-7400.10, qty. 2 P/N 115E-7400.11 and qty. 2 P/N 115E-7400.12) as shown in Fig. 1.
- 1.8.4 Release aircraft to service.

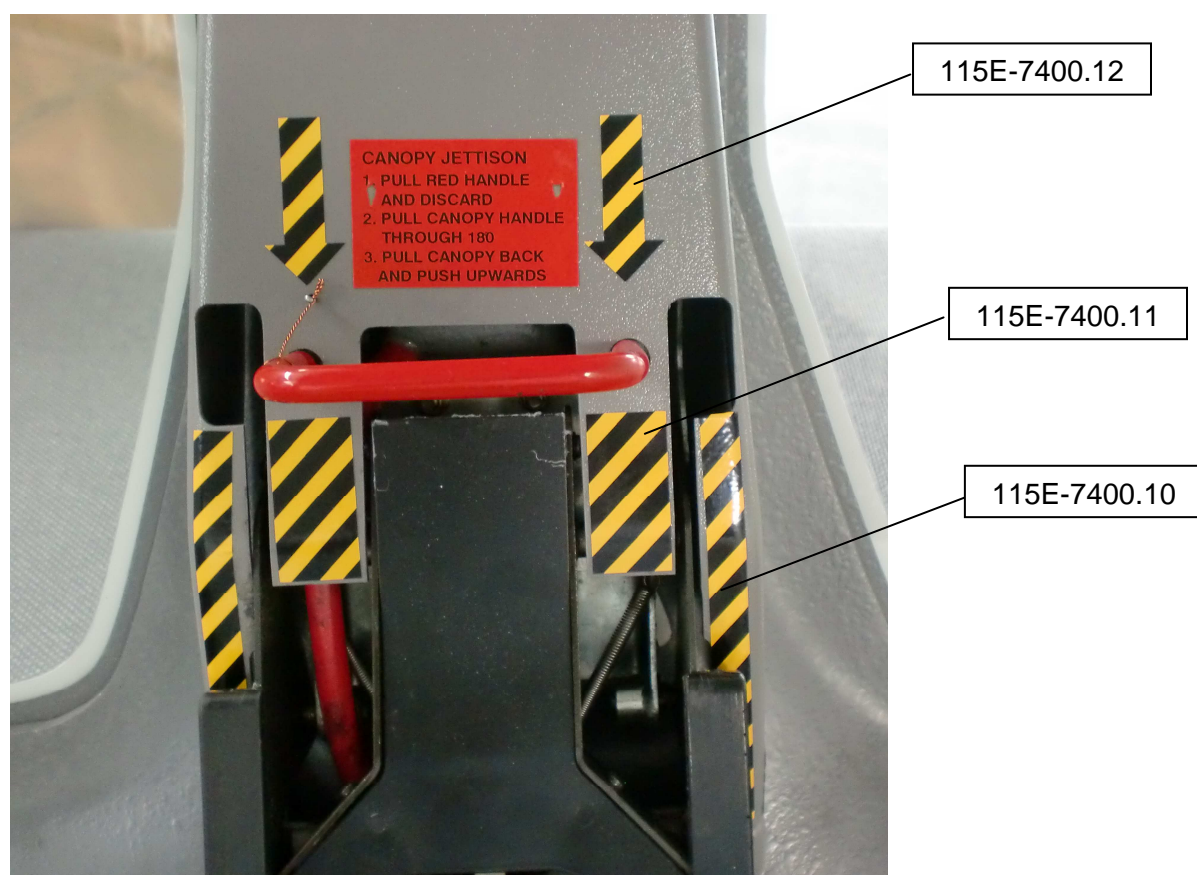


Fig.

### 1.9 Repetitive Actions

N/A

## **II. PLANNING INFORMATION**

### **2.1 Weight and CG**

N/A

### **2.2 Material and Availability**

Item	Part Number	Description	Quantity	Remarks
1	115E-7400.10	Adhesive marking	2	
2	115E-7400.11	Adhesive marking	2	
3	115E-7400.12	Adhesive marking	2	

### **2.3 Special Tools**

N/A

### **2.4 Labor costs**

0.5 hrs

### **2.5 Reference documents**

AMM for models listed in item 1.2  
IPC for models listed in item 1.2

### **2.6 Credit**

N/A

### **III. REMARKS**

- 3.1** The correct execution of the instructions in paragraph 1.8 may be performed by a competent person/ an authorized aviation workshop or at the manufacturer and has to be certified in the logbook by an authorized inspector.
- 3.2** If you have sold your aircraft in the meantime, would you kindly pass this information on to the new owner and forward his address and aircraft S/N to us.
- 3.3** For questions and assistance please contact:

Rudi Vodermeier,      Head of Customer Service & Support,  
phone:                    +49 8268 998139  
fax:                        +49 8268 998200  
e-mail:                    [productsupport@grob-aircraft.de](mailto:productsupport@grob-aircraft.de)

SB-Index:                <http://www.grob-aircraft.eu/service-and-support/g-115.html>  
Order:                    <http://www.grob-aircraft.eu/service-and-support/general/order-form.html>